


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-180	Smoke	7/21/2009	ADS/TM	S15AA_019MH	Dry	Yes	929.76

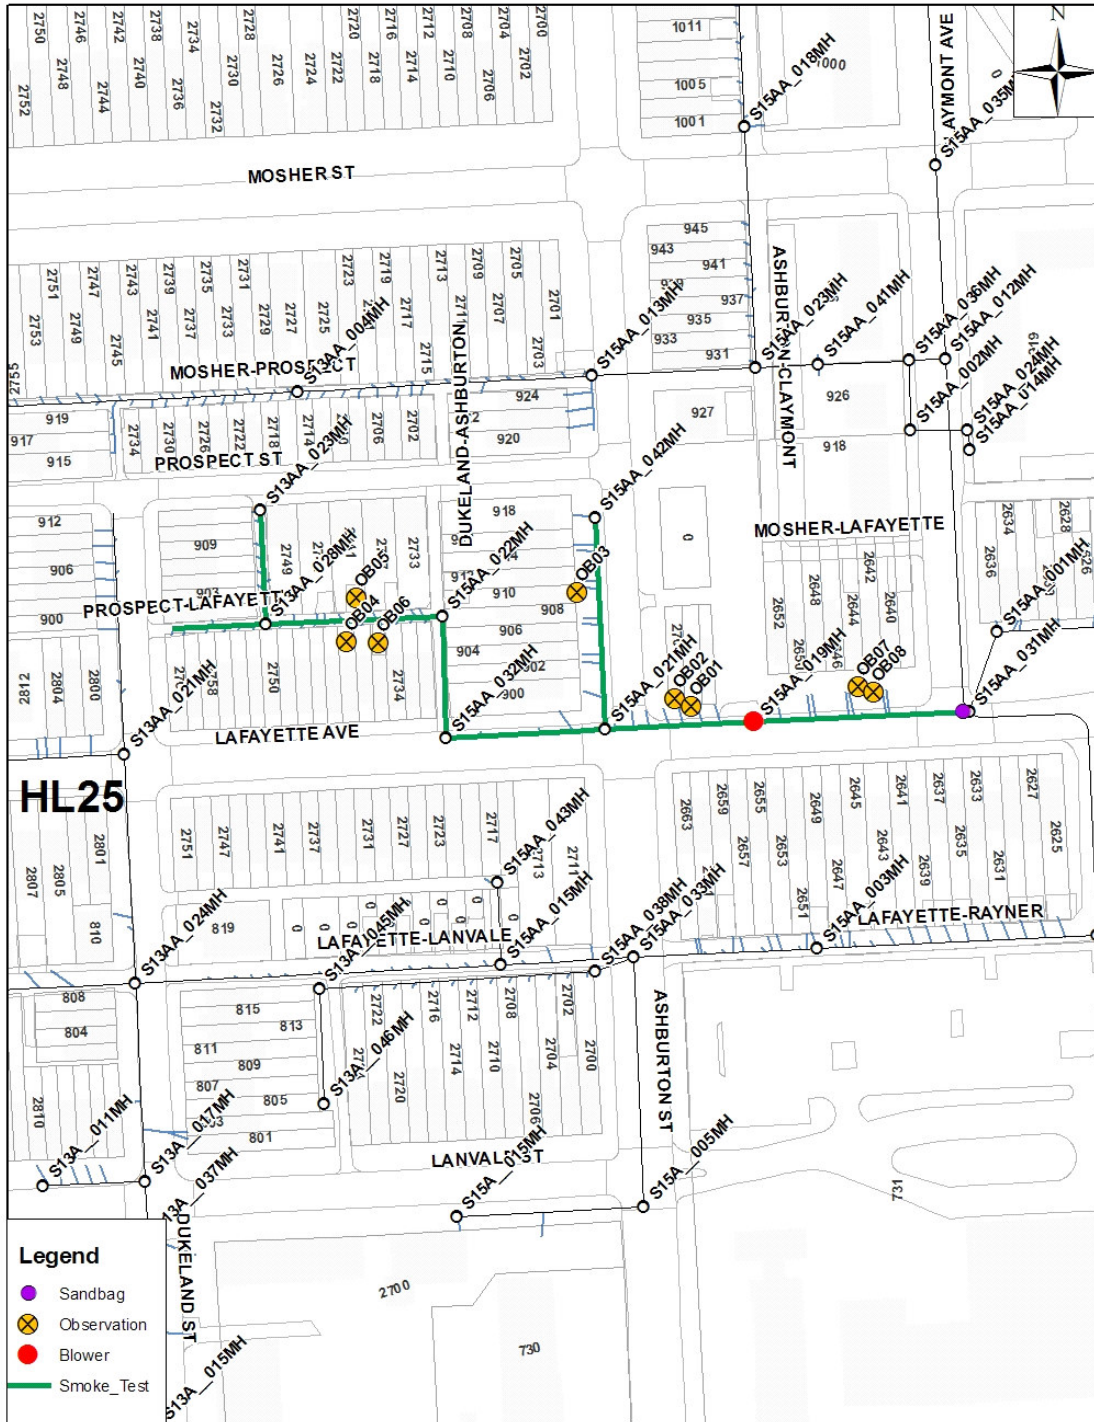

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-180	Smoke	7/21/2009	ADS/TM	S15AA_019MH	Dry	Yes	929.76

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S13AA_023G1	S13AA_023MH	S13AA_028MH	84.8666	8
S13AA_033G1	S13AA_033DE	S13AA_028MH	69.9157	8
S13AA_028G1	S13AA_028MH	S15AA_022MH	132.404	8
S15AA_022G1	S15AA_022MH	S15AA_032MH	91.6321	8
S15AA_032G1	S15AA_032MH	S15AA_021MH	119.137	8
S15AA_042G1	S15AA_042MH	S15AA_021MH	158.991	8
S15AA_021G1	S15AA_021MH	S15AA_019MH	112.051	8
S15AA_019G1	S15AA_019MH	S15AA_031MH	160.76	8


Observations & Photos

Obs_ID S1028-180-OB01
Address 2702 Lafayette Ave
Status Private
Source Cleanout

Location Yard - front

Nearest MH S15AA_021MH

Comments Smoke from cleanout (missing cap) in front yard. 2702 Lafayette Ave.

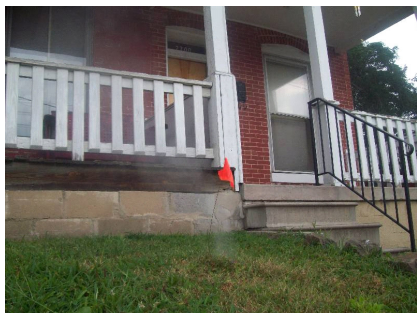

Picture \S1028-180-OB01-P01.jpg

Comments Front of house, 2702 Lafayette Ave.

Obs_ID S1028-180-OB02
Address 2704 Lafayette Ave
Status Private
Source Cleanout

Location Yard - front

Nearest MH S15AA_021MH

Comments Smoke from above-grade cleanout (broken cap) in front yard. 2704 Lafayette Ave.



Picture \S1028-180-OB02-P01.jpg

Comments Front yard, 2704 Lafayette Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-180	Smoke	7/21/2009	ADS/TM	S15AA_019MH	Dry	Yes	929.76

Obs_ID S1028-180-OB03

Address 910 Ashburton St


Status Private

Source Downspout Connect

Location Curb

Nearest MH S15AA_042MH

Comments Smoke from pipe outlet in curb at 910 Ashburton St. Possible connection to downspout.

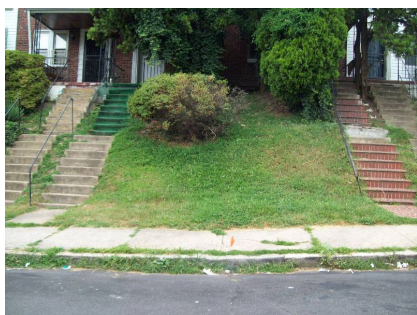

Picture \S1028-180-OB03-P01.jpg

Comments Front of house, 910 Ashburton St.

Obs_ID S1028-180-OB04

Address 2740 Lafayette Ave

Status Private

Source Cleanout

Location Paved concrete

Nearest MH S13AA_028MH

Comments Smoke from above-grade cleanout (missing cap) in back yard. 2740 Lafayette Ave.



Picture \S1028-180-OB04-P01.jpg

Comments Back of house, 2740 Lafayette Ave.

Obs_ID S1028-180-OB03

Address 910 Ashburton St

Status Private

Source Downspout Connect

Location Curb

Nearest MH S15AA_042MH

Comments Smoke from pipe outlet in curb at 910 Ashburton St. Possible connection to downspout.



Picture \S1028-180-OB03-P02.jpg

Comments Sidewalk, 910 Ashburton St.

Obs_ID S1028-180-OB05

Address 2741 Prospect St.

Status Public

Source Cleanout

Location Alley

Nearest MH S13AA_028MH

Comments Smoke from cleanout (missing cap) in alley behind 2741 Prospect St.



Picture \S1028-180-OB05-P01.jpg

Comments Back of house, 2741 Prospect St.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-180	Smoke	7/21/2009	ADS/TM	S15AA_019MH	Dry	Yes	929.76

Obs_ID S1028-180-OB06

Address 2736 Lafayette Ave


Status Private

Source Cleanout

Location Paved concrete

Nearest MH S15AA_022MH

Comments Smoke from above-grade cleanout (missing cap) in back yard. 2736 Lafayette Ave.

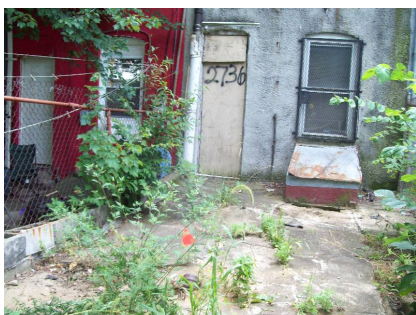

Picture \S1028-180-OB06-P01.jpg

Comments Back of house (location view), 2736 Lafayette Ave.

Obs_ID S1028-180-OB07

Address 2644 Lafayette Ave


Status Private

Source Cleanout

Location Yard - front

Nearest MH S15AA_031MH

Comments Smoke from above-grade cleanout (missing cap) in front yard. 2644 Lafayette Ave.

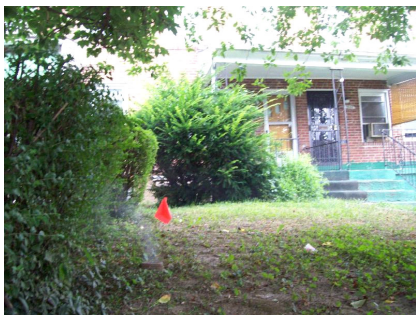

Picture \S1028-180-OB07-P01.jpg

Comments Front of house, 2644 Lafayette Ave.

Obs_ID S1028-180-OB06

Address 2736 Lafayette Ave

Status Private

Source Cleanout

Location Paved concrete

Nearest MH S15AA_022MH

Comments Smoke from above-grade cleanout (missing cap) in back yard. 2736 Lafayette Ave.



Picture \S1028-180-OB06-P02.jpg

Comments Back of house, 2736 Lafayette Ave.

Obs_ID S1028-180-OB08

Address 2642 Lafayette Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S15AA_031MH

Comments Smoke from below-grade cleanout (missing cap) in front yard. 2642 Lafayette Ave.



Picture \S1028-180-OB08-P01.jpg

Comments Front of house, 2642 Lafayette Ave.